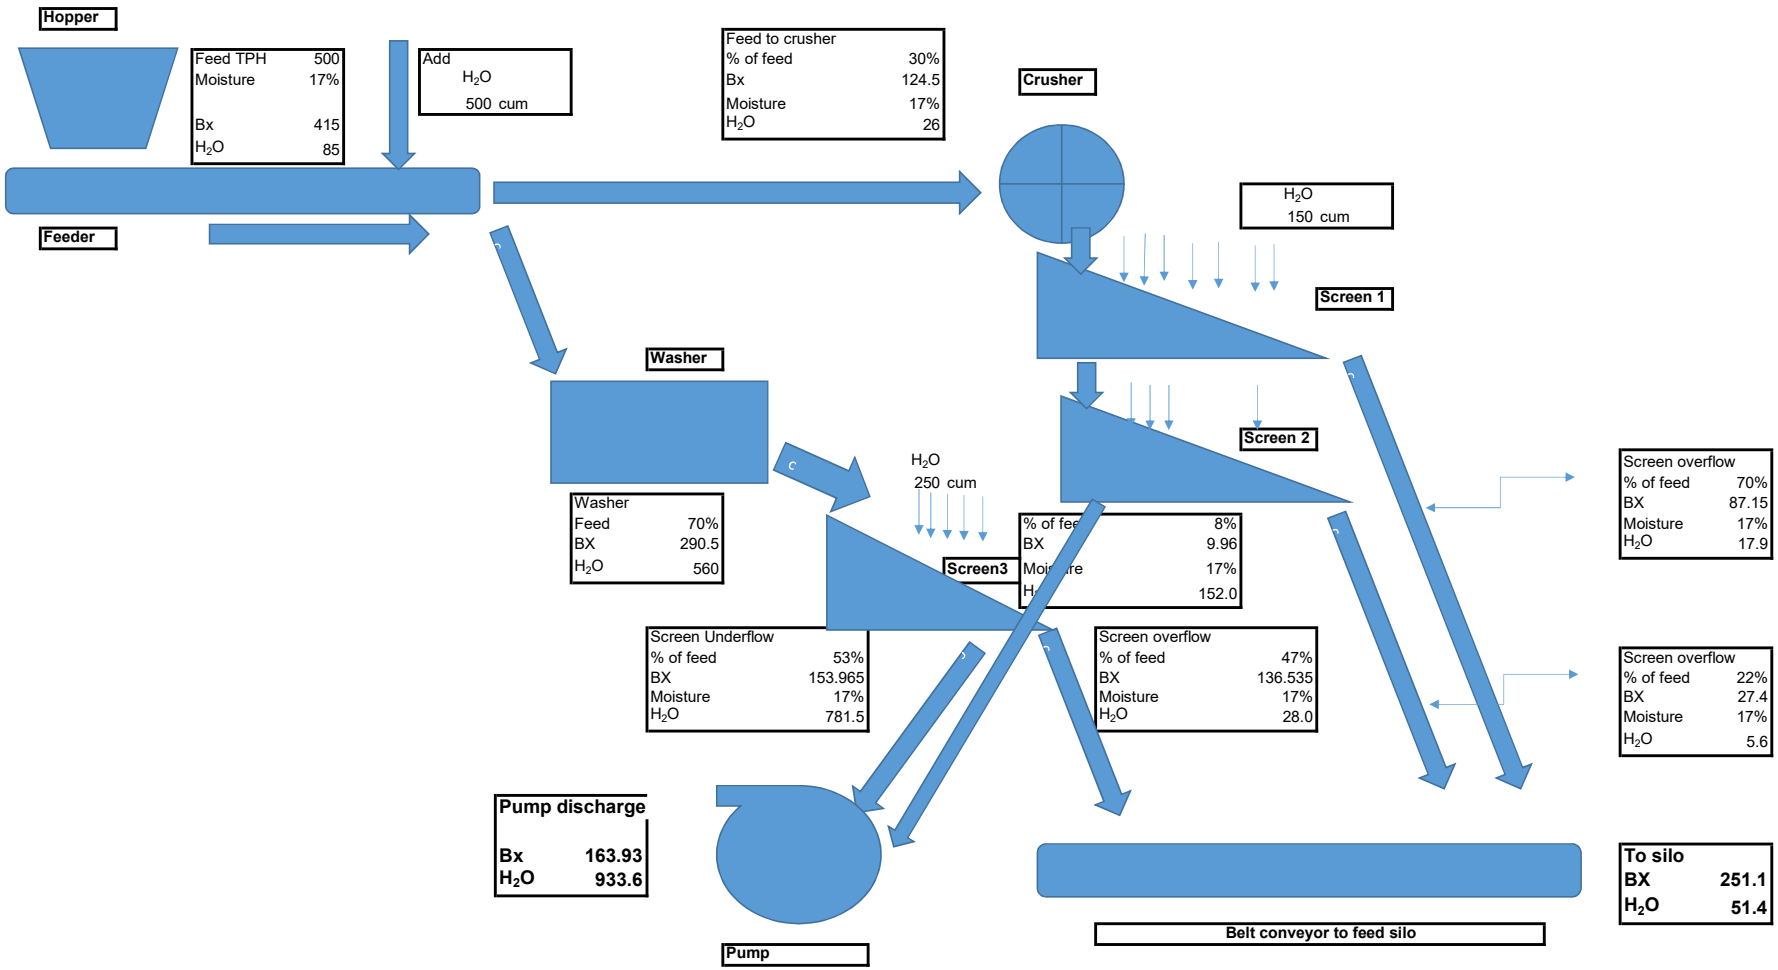
Hopper
Feed TPH 500
Moisture 17%
Bx 415
H_2O 85
Add
H_2O
500 cum
Feed to crusher
% of feed 30%
Bx 124.5
Moisture 17%
H_2O 26
Crusher
H_2O
150 cum
Screen 1
Feeder
Washer
Washer
Feed 70%
BX 290.5
H_2O 560
H_2O
250 cum
Screen2
Screen3
% of feed 8%
BX 9.96
Moisture 17%
H_2O 152.0
Screen Underflow
% of feed 53%
BX 153.965
Moisture 17%
H_2O 781.5
Screen overflow
% of feed 47%
BX 136.535
Moisture 17%
H_2O 28.0
Screen overflow
% of feed 70%
BX 87.15
Moisture 17%
H_2O 17.9
Screen overflow
% of feed 22%
BX 27.4
Moisture 17%
H_2O 5.6
Pump discharge
Bx 163.93
H_2O 933.6
Pump
Belt conveyor to feed silo
To silo
BX 251.1
H_2O 51.4